


sim. ISO 4026 - **DIN 913**
Hexagon socket set screws
with flat point

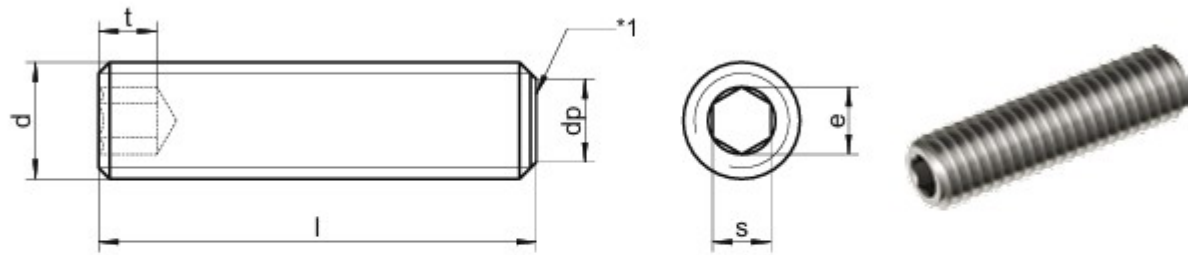

dp	0,75	1,25	1,75	2,25	3,20	3,70	5,20	6,64	8,14	11,57	14,57
t min.	0,8	1,2	1,2	1,5	2,0	2,0	3,0	4,0	4,8	6,4	8,0
t max.	1,7	2,0	2,0	2,5	3,0	3,5	5,0	6,0	8,0	10,0	12,0
s	0,9	1,3	1,5	2	2,5	3	4	5	6	8	10
e	1,003	1,427	1,730	2,300	2,870	3,440	4,580	5,720	6,860	9,150	11,430
●	0,9	1,3	1,5	2	2,5	3	4	5	6	8	10
Length / Ø	M2	M2,5	M3	M4	M5	M6	M8	M10	M12	M16	M20
2	▲ ●										
3	▲ ●	▲ ●	▲ ●	▲ ●							
4	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●					
5	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●					
6	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●				
8	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●			
10	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●			
12	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●		
14	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●		
16	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	
20			▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●
25			▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●
30			▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●
35				▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●
40				▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●
45					▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●
50					▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●
55						▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●
60						▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●
70						▲ ●	▲ ●	▲ ●	▲ ●	▲ ●	▲ ●
80							▲ ●	▲ ●	▲ ●	▲ ●	▲ ●
90								▲ ●	▲ ●	▲ ●	▲ ●
100								▲ ●	▲ ●	▲ ●	▲ ●
SU	500	500	500 ≥ 30 200	500 ≥ 12 200	500 ≥ 12 200	200	200 ≥ 35 100	100	50	25	25